

Carrier AC Installation Instructions

- 1) Locate Red Compressor wire on the Compressor and follow to electrical box Run Capacitor “C” terminal. Disconnect and splice the Red Compressor wire connection to the Brown ICM soft start wire.
- 2) Connect Red ICM soft start wire to the location of the previous Red Compressor wire terminal, Run Capacitor “C” terminal.
- 3) Connect Blue ICM soft start wire to the “H” terminal on the Run Capacitor.
- 4) **IF** you see a second wire next to the Blue Compressor Wire, disconnect it and seal end with electrical tape.
- 5) Locate the Yellow wire coming out of the Compressor overload switch, route and 3-way splice the final Black soft start wire to a convenient location along the Compressor Yellow wire.
 - a. There may be an Overload Protector after the Compressor overload switch, in which case, you would 3-way splice the Black ICM soft start wire **after** the Overload Protector.